

STEREO MOC Status Report  
Time Period: 2018:113 - 2018:119

STEREO Ahead (STA) Status:

1. The following Ground System anomalies/events occurred during this reporting period:

- On day 115, during the DSS-55 support, turbo decoder lock was lost intermittently at 1539z through 1555z due to rain at the Madrid complex. The SSR pointers were repositioned to minimize data loss. This anomaly resulted in the loss of 22,131 frames of real-time telemetry and SSR data. All SSR data was recovered. See DR# M110566 for more information.
- On day 117, during the DSS-43 support, turbo decoder lock was lost briefly at 0603z. This anomaly resulted in the loss of 1 frame of SSR data.
- On day 118, during the DSS-14 support, turbo decoder lock was lost intermittently from 2037z through 2045z, then telemetry lock was lost at 2059z through 2223z, all due a sub-reflector issue at the station. This anomaly resulted in the loss of 1.5 hours of commanding, tracking, real-time telemetry, and SSR data. See DRs #G119083 and G119084 for more information.
- On day 119, during the DSS-35 support, telemetry lock was lost at 0440z through 0502z followed by intermittent loss of turbo decoder lock through 0533z due to heavy rain at the Canberra complex. This anomaly resulted in the loss of 24 minutes of commanding, tracking, real-time telemetry, and SSR data. See DR# C113406 for more information.

2. The following spacecraft/instrument events occurred during this week. The Ahead observatory operated nominally during this week.

- On day 119, the star tracker failed to find a solution at 15:20:46z. Fault protection soft reset the star tracker and promoted it back to AAD mode 15:24:01z. Diagnostic data indicated the reset cause was due to a CPU Error, which has occurred previously. With no X-axis rate data available to G&C, a 1.2 degree X-axis roll error occurred

which resulted in the loss of fine pointing for a total of 6.2 minutes, from 15:22:05z through 15:28:16z. This was the 7<sup>th</sup> star tracker reset on the Ahead observatory since launch.

- The average daily science data return for Ahead was 6.2 Gbits during this week.

STEREO Behind (STB) Status:

1. Detailed status of the recovery activities this week to restore operations is listed below.
  - None.
2. The Behind loss of communication anomaly occurred on October 1, 2014 from simultaneous failures of the star tracker and the IMU. Post superior solar conjunction, recovery operations resumed on November 30, 2015. By implementing the NASA Failure Review Board recommendations, the first recovery attempt began with carrier detection by the DSN on August 21<sup>st</sup>, through September 23, 2016. At a spacecraft range of ~2 AU, the observatory was found to be rotating slowly about its principal axis of inertia for which the uncontrolled attitude allowed some solar array input and continuous uplink and downlink communications on the LGA at emergency data rates. Over the next 22 continuous days, significant obstacles to recovery were overcome with a collaborative effort of the JHU/APL engineering team, NASA GSFC, DSN, FDF, SSMO scheduling, and Mission Operations teams. This consisted of:
  - Reliably commanding a rotating spacecraft with uncontrolled attitude at a distance of 2 AU
  - How to power on the spacecraft that was never designed to be off without collapsing the battery voltage
  - Acquiring telemetry at 35 bps from a spacecraft that is rotating with an uncontrolled attitude
  - Warming a frozen propulsion subsystem with a degraded battery and limited solar array input with an uncontrolled attitude
  - Configuring, loading, and verifying EA, C&DH, and G&C parameters and macros with very limited telemetry
  - Conducting an autonomous momentum dump in the blind and transitioning to C&DH standby mode and successfully

receiving telemetry on the HGA indicating star tracker lock and decreasing system momentum.

However, system momentum level remained above the threshold for re-establishing attitude control with the reaction wheels. Due to the uncontrolled attitude, communication degraded and the last detection of the carrier was on September 23, 2016.

Behind Observatory Status - From the last telemetry received on September 18, 2016 and the telemetry assessment review held on February 24, 2017, main bus voltage is low, 3 out of 11 battery cells are bypassed, and attitude remains uncontrolled, rotating about its principal axis of maximum moment of inertia. While likely all ~42 kg of hydrazine remains and is frozen, both pressure transducers are not functioning. EA mode is enabled and autonomy is disabled. The battery charge rate is C/10. RF is configured for the +Z LGA at emergency data rates and the range of the expected best lock frequency (BLF) is known.

In July 2017, with collaboration with GSFC, the recovery plan was revised and 61 procedures were developed and tested. Significant improvements include:

- Using the -Z LGA as it provides 2 dB more than +Z LGA
- Recovering in C&DH standby mode to better protect the battery
- Minimize fault protection usage
- Close latch valves after each thrusting operation
- Refined autonomous momentum dump to re-establish 3-axis attitude control
  - o Use IMUA as it will leave solar arrays Sun pointing
  - o Power wheels on after momentum dump

After 2.5 months of daily recovery efforts that began on August 21, 2017, to date the downlink signal has not been detected by the DSN block V receivers or the RSR team. With significant support of the DSN, two different acquisition sequences are being utilized monthly to re-establish communications with STEREO Behind using a 70m track:

1. 1 kHz Frequency Segmented Sweep - consists an 18 kHz frequency range divided into 18, 1 kHz segments, each swept at a 1 kHz rate, stepping down in frequency and them back up again. During each segment, the MOC sends battery recovery commands on the first day and on the

second and third days, carrier recovery commands. This was the acquisition sequence that originally detected the Behind downlink in August 2016.

2. 4 kHz Sweep with Search Pattern - The DSN created a diamond shaped search pattern with 7 steps of 0.037 deg, dwelling 10 min & 49 sec/step. There are two diamond patterns of 4 steps to cover the area of the estimated ephemeris error. The starting point is offset 0.02 deg for 100% uplink optimization. Repeating each diamond pattern accounts for the 30 minute RTLT. This search pattern acquisition sequence is used twice weekly during 3 hour supports, sending battery recovery commands at each step during the first day and on the second day, sending carrier recovery commands at each step.

Recently the DSN refined their telemetry extraction process from low signal levels and was able to deliver 18 new frames from the BEHIND recovery, all post momentum dump. While nothing new was discovered, much of the following observations confirm what was known:

- Battery temperature was at 52.72 deg C (upper telemetry limit), probably higher due to an overcharge condition
- Latch valve telltales appear to be functioning
- Last-minute commands sent to shed main bus load were received as the main bus current dropped about 6A
- The IMU was flagged invalid throughout the period
- The star tracker was tracking and enabled throughout
- After all commanded thruster firing had terminated the angle between the angular momentum vector and sun vector steadily increased at ~0.03 deg/min. This tends to further support the hypothesis that something was being expelled.